

# **30cm Gas Cooktop 2 Burners Stainless Steel**

### **TRG302SS**



GENERAL	
Туре	Built-in
Size	30 cm
Finish	Stainless Steel
Functions	Knob
Technical specification	
Voltage Rating	220–240 V AC 50/ 60 Hz
Max Rated Inputs	0.0008KW
Cooking Zones	2 Burner
Mains Supply Lead	3 core x 0.75mm <sup>2</sup> (Type RR-F <har> marked)</har>
Туре	Natural Gas (1.0 KPa) LPG (2.75KPa)
Power Cord	1 m
Mains cable	Yes
сооктор	
Burner Configuration	2- Gas Burner
Front	1 x 10.8 MJ/h rapid burner (NG)
Rear	1 x 14.4 MJ/h triple crown (wok) burner (NG)
Pan Support Type	Cast Iron Continuous Pan Supports
DIMENSIONS	
Cut-Out Dim. (W x H)	268 x 480 mm
Product Dim. (W x H x D)	310 x 510 x 40 mm
Product Weight	5.8 kg
Packed Dim (W x H x D)	335 * 555 * 145 mm
Packed Weight	7 kg

### **KEY FEATURES**

- Front control operation
- Automatic ignition
- Heavy duty metal pan stands
- Flame failure safety device on each burner
- Wok Support
- Cast Iron Trivets


NOTE TO THE INSTALLER: Dimensions, specifications and drawings not to scale and to assist as a guide only. Trinity Appliances reserves the absolute and unrestricted right to change product materials and specifications, at any time, without notice. Physical product measurements of actual product must be taken prior to installation and making a cutout. Proper installation is the responsibility of the installer.

Product failure due to improper installation is not covered under the Product Warranty.





# **30cm Gas Cooktop 2 Burners Stainless Steel**

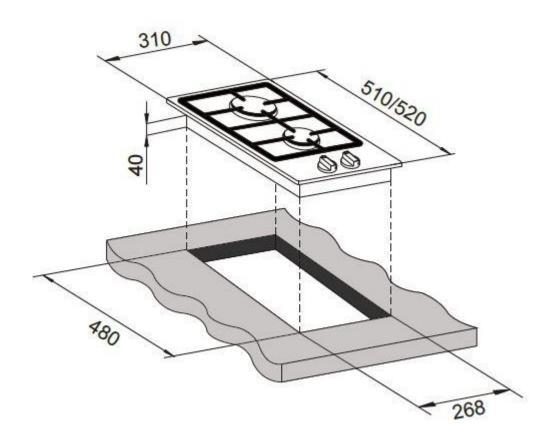

## **Product Dimensions Cut-Out Dimensions**

Height: 510mm 480mm Width: 310mm 268mm

Depth: 40mm

NOTE TO THE INSTALLER: Dimensions, specifications and drawings not to scale and to assist as a guide only. Trinity Appliances reserves the absolute and unrestricted right to change product materials and specifications, at any time, without notice. Physical product measurements of actual product must be taken prior to installation and making a cutout. Proper installation is the responsibility of the installer.

Product failure due to improper installation is not covered under the Product Warranty.

